Concerning PRC-024-2 the VDH/GSMI Supports Differentiation between Internal and External Faults

Thomas Wilkins Wilkins Consulting Henderson Nevada U.S.A. wilkinsa@wilkinsalternatives.com

Steve Quade E.E. Blattner Energy Avon Minnesota U.S.A <u>steveq@blattnerenergy.com</u> Miles Downing Downing Consulting Engineers, PLLC Portland Oregon U.S.A. <u>miles@downingengineers.com</u>

DISCLAIMERS AND NOTICES

This report was prepared with references that incorporate work sponsored by private corporate persons, individual(s), or those with an agency of the United States government, as such this disclaimer presented includes references with disclaimers and any such disclaimers are incorporated herein; whereas neither the corporate persons, individuals, or United States government nor any agency thereof, nor any agent, agents or groups of agents acting as principle or agent, make any warranty, express or implied or assumes any legal liability or responsibility for the accuracy, completeness, or usefulness of any information, apparatus, product, or process disclosed or represents that its use would infringe privately or publicly on owned rights. References herein to any national, international, public or private commercial product, process, or service by tradename, trademark, manufacture, or otherwise does not necessarily constitute or imply endorsement, recommendation, or favoring by any of the authors, sponsors, references, governmental organizations, agencies, individual, or corporate persons.

FAIR USE NOTICE

The material present herein is provided for educational purposes and informational purposes. It may contain copyrighted material the use of which has not always been specifically authorized by the copyright owner. It is being made available in an effort to advance the understanding of scientific, environmental, economic issues etc.... It is believed that this notice is fair use of any such copyrighted work incorporated herein as provided for in section 107 of the U.S. Copyright Law. In accordance with Title 17 U.S.C Section 107, the material incorporated in this report by reference or otherwise is distributed to those who receive it upon condition it is a presentment for educational purposes only. Those who use this information beyond fair use you must obtain permission from the copyright owner.

Abstract—Because the interlocked combine breaker grounding switch (VDH/GSMI, a medium voltage vacuum circuit breaker with mechanically interlocked grounding switch) can help with differentiating between internal faults and external faults, as such, generators would know via the voltage measured at their terminals if a fault was outside the plant and keep running, to meet PRC-024-2 under voltage ride-through requirements with zero volts at the point of interconnection. Converselv. with respect to internal disturbances, the VDH/GSMI creates a three-phase bolted ground that causes the generators to either shut down or island into very low impedance and can operate while they wait for the remote trip signal from the substation, where a regular circuit breaker opening would cause high impedances to appear on the home run cable. The generators and high impedance create possible temporary overvoltages that would damage equipment on the separate collection circuit.

PSCAD models show the VDH/GSMI allows generators to differentiate between internal faults and external faults. NERC PRC-024-2's [15] written purpose is to ensure generator owners set their generator protective relays such that generating units remain connected during defined voltage excursions and operate down to zero percent voltage at the point of interconnect (POI) for nine cycles. PSCAD simulations show the VDH/GSMI when it opens and clears and then closes to ground causes the voltage at the mains of each generator on the affected circuit to go below 9% which is significantly below 15% concerning certain ride through requirements. As a benefit, the VDH/GSMI causes the plant to better support the transmission system by providing a differentiating voltage signal between internal and external faults. When the VDH/GSMI is closed, the voltage is higher at the terminals of the generator during zero voltage at the point of interconnection.

PRC-024-2 requires power plants set their relays so that the plant remains connected during voltage excursions, such that the generator voltage protective relaying does not trip within the no trip zone as measured at the POI; the no trip zone in part includes nine cycles at zero volts. PSCAD simulations indicate the VDH/GSMI can help engineers provide such required PRC-024-2 functionality.

Keywords—interlocked, combine, breaker, grounding, switch, remote, transfer, trip, wind power plant, solar power plant, wind, solar, electric, power, system, flash, arc, blast, temporary overvoltage, lightning arrestor, collection circuit, cable, transformer, single line to ground fault, wind, solar, arrestor coordination, grounding transformer zero volts at nine cycles.

1. INTRODUCTION

We set out to find if the interlocked-combine-breaker grounding switch (VDH/GSMI) coordinates well with PRC-024-2 (HVRT-LVRT) requirements when the fault is inside and outside a wind or solar power plant, because the VDH/GSMI does not require a delay to operate. When the VDH/GSMI <u>opens and clears and then closes to ground</u> the home run cable, it is expected the voltage will drop below significantly. Should the fault appear outside the plant for nine cycles with near zero volts, at full power, we expect for the same conditions with near full active power that the voltage measured at the generators should be higher when there is zero voltage at the point of interconnection (POI) than when the VDH/GSMI opens and then grounds the collection circuit, thus providing a level of discrimination for protection and trip as measured at the terminals of each individual generator within the solar power plant or wind power plant.

With the above in mind, generators are expected to shut down quickly; or if they island, they island into a three-phase bolted ground, and they can wait for the remote trip signal without creating overvoltage and other damage.

In this paper PSCAD is used to describe the design and theory of operation of the VDH/GSMI as it is applied in wind power plants and solar power plants, and the very low impedances to ground the VDH/GSMI creates in which the low impedance causes very low voltage to appear on the separated collection circuit. The operation of the VDH/GSMI with PRC-024-2 requirements coordinates well with other plant functions during a ride-through event.

The VDH/GSMI is an improvement and evolution in circuit breaker design. Circuit breakers come in a variety of forms: Vacuum, air, and gas-insulated switchgear are available for medium-voltage systems, such as a 34.5 kV collection circuit of wind power plant or a solar power plant. Circuit breakers are mechanical switching devices, which connect and break the current flowing in the circuit, which can be the nominal current or the fault current. Typical circuit breakers comprise one switch that is either open or closed. Generally, wind power plants and solar power plants only use non-grounding feeder (line) circuit breakers.

When considering a collection circuit for a wind power plant or a solar power plant, the typical circuit breaker clears the affected feeder from the main station transformer and the transmission system. However, such a design is limited and does not provide the same functionality as the VDH/GSMI, functionality, such as anti-islanding or temporary overvoltage mitigation, needed for today's modern wind power plants or solar power plants.

Another special type of circuit breaker provides a lot more functionality and protection. This circuit breaker is called the VDH/GSMI; see [1] and [2]. The VDH/GSMI requires only one signal from a relay to separate the collection feeder circuit from the main plant transformer. Then the interlocked switch grounds the collection circuit; the full process occurs in about three cycles from the initiation of a fault. With the impedance of the collection circuit cables approximately 1/15th of the impedance of an individual wind turbine transformer, and with

The VDH/GSMI is essential element for meeting over/under voltage ride through requirements such as those found in PRC-024-2 Page 3 of 25 all three phases effectively bolted to ground, the voltage on the separated feeder quickly collapses.

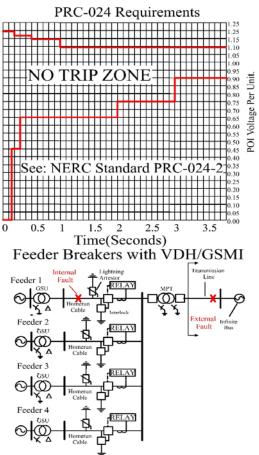


Fig. 1: Wind Power Plant or Solar Power Plant Single Line.

The National Electric Reliability Corporation (NERC) that acts as an electric reliability organization (ERO) requires relay settings and wind or solar power plants to operate down to zero volts for nine cycles as shown in PRC-024-2 shown in Figure 1. The VDH/GSMI can help wind or solar power plant designers and engineers provide the functionality required by NERC as specified in PRC-024-2.

The VDH/GSMI shown in Figures 1,3,4 and 11 is designed for the feeder collection circuits of wind power plants and solar power plants. The line-side circuit breaker is composed of vacuum interrupters and bushings to connect to the 34.5 kV collection circuit. For information about the operation and ratings of vacuum interrupters, see [7] and [8]. The grounding circuit when closed connects the generator's side of the feeder collection circuit to ground. The VDH/GSMI within wind power plants and solar power plants connects between the substation bus and the wind turbines or solar inverters as shown in the single line in Figure 1.

In wind power plants and solar power plants, conventional breakers open and disconnect the affected feeder from the transmission system and then allow the delta connected

VDH/GSMI Interlocked Combine Breaker Grounding Switch

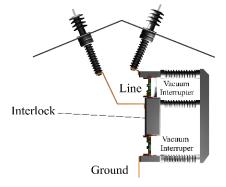


Fig. 2: Combine Breaker Grounding Switch (VDH/GSMI). A set of three line-side phase vacuum interrupters and a set of three ground vacuum interrupters are interlocked and operate with one trip signal.

collection circuit to operate without a ground reference (except through the cable susceptance or lightning arrestors), unless a grounding transformer is connected to the collection circuit. If the grounding transformer provides a reference to ground, however, it is found to provide only a zero sequence path to ground but not a positive or negative sequence path, and consequently is not found to significantly lower collection circuit voltages during islanding [3], [19]. Concerning IEEE standards, they are found to refer to zero sequence impedance while presenting their claims, but what about the positive and negative sequence current from the generators? How can a grounding transformer with an open secondary pass such energy?

In [19] we found the VDH/GSMI, in coordination with lighting arrestors provides a better positive, negative and zero sequence ground reference than a grounding transformer and opens with an electrical switching of time of 4–12ms, or less than one cycle, thus grounding the collection circuit without delay and allowing the unaffected feeders to generate and provide support during a ride-through event.

Figure 1 shows the single line for a wind power plant or solar power plant, with the VDH/GSMI; where the interlock and grounding switch are on four collection circuits or feeders. Figure 1 shows the home run cable and the Generator Step Up Transformer (GSU) where the GSU is the equivalent of many generators. Figure 1 also shows the delta side of the GSU indicating that the home run cable will float once the line breaker opens. However, the VDH/GSMI will within 38ms from receiving a trip signal, close and ground the affected collection circuit; where 16ms earlier it mechanically began to operate and 4–12ms earlier it electrically began to extinguish the arcs and ground the home run cable. All with one single trip signal.

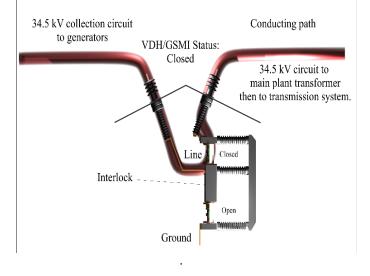


Fig. 3: VDH/GSMI Closed, Ground Switch Open.

Figures 2 and 3 show the VDH/GSMI when it is closed (the ground switch is open). The red bold line indicates the electric path from the generators on the feeder to the main plant transformer. Figure 4 shows the VDH/GSMI open where the feeder is grounded as shown with the green path. The home run cable's three phases are bolted to ground. By bolting to ground the home run cable of a feeder, the generators see very low impedance while islanding. Generally, wind power plants and solar power plants should remain on-line during voltage disturbances for specified time periods per PRC-024-2 as shown in Figure 1, where such periods include a transition period and a post-transition period with normal clearing times of four to nine cycles [15].

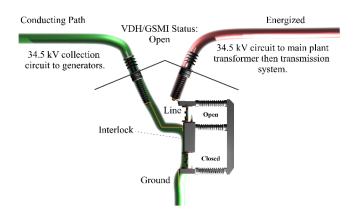


Fig. 4: VDH/GSMI Open, Grounding Switch Closed.

2. FERC ORDER 661 AND NERC PRC_024-02

Concerning FERC order 661, wind-generated power plants are required to continue to generate power (e.g., in service) during three-phase faults with normal clearing. Generally, the clearing time and the voltage ride through for a wind power plant for a three-phase fault is nine cycles at a voltage as low as 0.15% of nominal, as measured at the high side of the wind-generated plant step-up transformer at the point of interconnection. Many generator manufacturers can operate with this specification for individual generators. However, NERC issued standard PRC-024-2; this standard requires more than nine cycles at zero voltage as measured at the point of interconnection (see Figures 5 and 6).

For years, NERC, an electric reliability organization, has been presenting and reaffirming that a fault that occurs on a transmission line near a wind power plant could cause the voltage at that point to drop to zero. NERC states that allowing a wind power plant or solar power plant to disconnect when the voltage drops below 15% from the nominal at the point of interconnection, the loss of a transmission line and the loss of the real power (and any reactive power) produced by the wind power plant or solar power plant results in a double contingency event (loss of the transmission line and the wind power plant or solar power plant) [16].

To provide a remedy for this problem, NERC requested that wind power plants as shown in Figure 1 should be altered so that for 150 ms if the voltage at the point of interconnection is reduced to zero the plant would ride through. If after 0.300 s the fault persists, the wind power plant or solar power plant stays connected as long as the voltage is at or above 0.45 pu of nominal voltage. It is presumed that NERC presents such conditions to reduce the risk to the reliability of the electric power system to an acceptable level.

In this section, the VDH/GSMI as shown in Figure 8 provides support for a generation plant concerning PRC-024-2 and ride-through capabilities concerning the many types of faults. For internal and external faults, the VDH/GSMI is shown to provide clear different high (external) and low (internal collection circuit fault) signals to the generators. After the VDH/GSMI opens and clears and then closes and grounds, the resulting line to ground impedance on the home run cable is significantly reduced. With that in mind, the VDH/GSMI provides "easy" islanding capability where the voltage remains very low. As PRC-024-2 requires nine cycles of ride-through capability, with zero voltages at the point of interconnection, the VDH/GSMI supports the generators by providing a voltage level that indicates whether the fault is inside or outside the plant to an individual generator.

3. VDH/GSMI AND PRC-024-2

This section concerns how the VDH/GSMI provides support for a generation plant regarding PRC-024-2 and ridethrough capabilities for the many types of faults. After the VDH/GSMI opens and then closes, the line to ground impedance on the home run cable is significantly reduced. With that in mind, the VDH/GSMI provides "easy" islanding capability where the voltage remains very low. As PRC-024-2 requires nine cycles of ride-through capability, with zero voltages at the point of interconnect, the VDH/GSMI provides engineers and designers with an option they do not have with a typical feeder breaker such as, a grounded feeder.

If the fault is within the plant, such a fault can be isolated from the wind power plant and the transmission system with the VDH/GSMI separating the affected collection circuit. The unaffected feeders are able to ride through and remain on-line. The VDH/GSMI and the ride-through capabilities of the generators work together to meet the regulatory requirements specified in the U.S. Federal Energy Regulatory Commission (FERC) Order 661 and NERC PRC-024-2.

Many types of faults can occur. However, in this paper we consider internal single line faults to ground and external three phase bolted faults. The faults can be within a wind power plant or a solar power plant or outside a wind power plant or a solar power plant. The fault can be on a collection circuit, at a generator, or in a substation. The fault impedance can be high or low; it can be steady or pulsing. Given all the faults and types and locations, the transmission provider requires that the wind power plant or solar power plant ride through and discriminate when it should and should not ride through concerning internal and external faults (see Figure 7). The VDH/GSMI is an essential part of fulfilling such requirements.

When the VDH/GSMI provides such low impedance when it grounds the home run cable, the generators either know to shut down when the VDH/GSMI operates or allow the generators to remain on-line and generate into a bolted three-phase to ground, and allow the protection system to send a remote signal to shut down the generators (see Figure 7). By providing symmetry to a faulted collection circuit it reduces mechanical stress during islanding. Figure 7 shows oscillations disappearing after the VDH/GSMI closes.

The VDH/GSMI provides easy islanding.

If the fault is external on the transmission system and the voltage is zero volts, the VDH/GSMI provides discrimination that other circuit breakers do not because when it operates it provides a clear signal to the generators that the main plant transformer is or is not part of the circuit. If the fault is on the transmission system, the VDH/GSMI is not expected to operate, similar to other regular breakers. What makes the

VDH/GSMI different is that it can ground the collection circuit and provide a clear reference to ground.

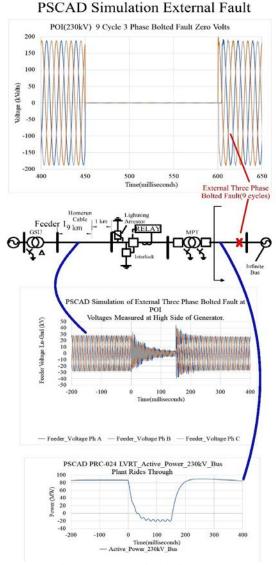


Fig. 5: PSCAD Simulation External Fault.

230 kV (near) Zero Voltage 9 Cycle Three Phase Bolted Fault at POI Generators Ride Through RMS Values

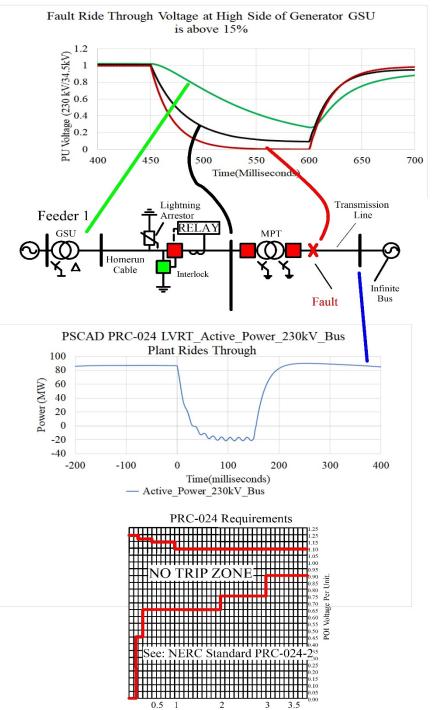


Fig. 6: PSCAD Simulation Voltage Curves during nine Cycles of (Near) Zero Voltage at the POI.

The VDH/GSMI is essential element for meeting over/under voltage ride through requirements such as those found in PRC-024-2 Page 7 of 25

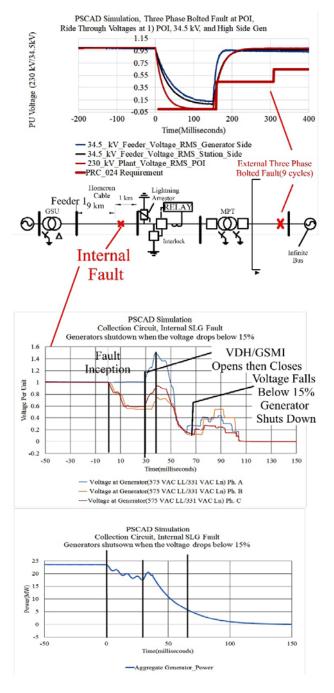


Fig. 7: VDH/GSMI Ride-Through Voltages

The impedance of a home run cable can be between 1 ohms and 2 ohms, and the current sourced on a 34.5 kV collection circuit can be 500 amps. The generators can limit the current during a fault. Once the VDH/GSMI separates the affected collection circuit from the plant, the fault current is reduced from more than 15 kA to 0.5 kA. When the VDH/GSMI grounds the home run cable, the impedance of the affected collection circuit is now down to 1 to 2 ohms at the home run cable. With 0.5 k Amps and 1 to 2 Ohms, the voltage rise is around 3–5% at full power. The current from

the 2 MW generator at 34.5 kV is approximately 40 Amps with a series impedance through its generator step-up transformer of 5.5% (3 MVA); therefore, the voltage increases across the GSU would be a maximum of approximately 4% to 5%. To sum up, the rise from the home run cable to the mains of the generator on the low side is projected to be less than 10%, where some PSCAD simulations demonstrated 12% or less due to asymmetry at the low side of the generator and on the collection circuit and added reactive power flow during a single line to the ground fault (see Table 1 and Figure 7).

	PSCAD Plant Impedances		
	Main Plant	10 km 1000	Generator Step-
	Transformer	MCM	up Transformer
		Home Run	[Equivalent]
		Cable	
% Z	8	N/A	5.5
MVA	90	N/A	1 Gen=3MVA 10 Gen =30MVA
Ohms	J1.05 ohms	J 2 ohms	J 21.8 / J 2.18 Ohms
Was it part of the External Fault PSCAD simulation?	Included	Included	Included
Was it part of the internal fault PSCAD simulation?	Excluded. Measurements taken from generator side of VDH/GSMI after VDH/GSMI opens and then closes.	Included	Included

Table 1: Impedances included in PSCAD simulations

PRC-024-2 requires the facility to operate down to zero percent of the rated voltage. With PRC-024-2 in mind, the VDH/GSMI provides three functions for a wind power plant or solar power plant:

- a low impedance for a separated collection circuit to generate.
- a low voltage for the wind turbines to recognize that they can shut down
- a low impedance to mitigate severe islanding; if there are plant conditions that require the generators to operate below 0.15 per unit, the low impedance on the collection circuit provided by the VDH/GSMI allows a remote trip signal to get to the generators to shut them down without causing overvoltages or damage to the collection circuit.

While a regular breaker separates a faulted collection circuit from the plant and the transmission system just like the VDH/GSMI, a regular breaker does not ground the collection circuit and does not provide the functionality of the VDH/GSMI. A regular breaker opens and causes high impedance to appear on the collection circuit resulting in temporary over voltage (TOV) and damaging voltage on the collection system. A regular breaker does not provide very

The VDH/GSMI is essential element for meeting over/under voltage ride through requirements such as those found in PRC-024-2 Page 8 of 25 low voltage as a discrimination function for generators to detect; therefore, generators are left to island for long periods of time. In contrast, the VDH/GSMI provides differentiation between internal and external faults in wind power plants and solar power plants (Figure 8) allowing for the generator to quickly shut down.

The VDH/GSMI does not require delays for clearing a fault on a collection circuit with PRC-024-2. However, a regular breaker may require a delay in clearing the fault from the plant, and therefore, the other unfaulted collection circuits are exposed to longer internal plant fault times where the plant as whole is impacted. Such an impact may degrade the plant's dynamic reactive power performance; if a VDH/GSMI had been installed, the faulted circuit could be cleared as fast as possible. Faster clearing allows the plant to transition back to prefault voltages and improved dynamic support of the transmission system.

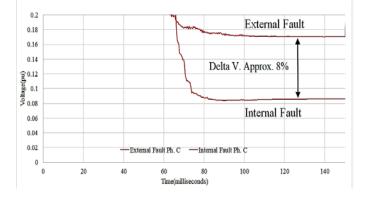


Fig. 8: Differentiation between an External Fault at POI and Internal Fault on Collection Circuit.

4. GROUNDING BREAKER OPERATIONAL OVERVIEW

This is an operational overview of VDH/GSMI for wind power plants and solar power plants. To describe the design and operation of the VDH/GSMI, the focus of this overview is on a feeder circuit within a wind power plant or solar power plant and the change in impedance that occurs when a fault appears on the collection feeder home run cable (Figure 10). The PSCAD simulation of the operation of a grounding breaker demonstrates that it grounds the collection circuit.

Figure 9 shows the states of the VDH/GSMI: 1) Closed, the line breaker is closed, and the ground switch is open; 2) Transition, both switches are open; and 3) Open, the line switch is open, and the ground switch is closed. The grounding breaker operation has two distinct states of operation: open and closed. However, a transition state is

included between the two states. Therefore, there are three states in total with a mechanical operating time of 16 ms and

an electric clearing time of 12 ms. They are given in Table 2.

Closed status means the line interrupters are closed, and the ground interrupters are open. The transition state includes the coincident operation of the two interlocked vacuum interrupters with at least one trip command from a relay (Figure 10). First, the line (breaker) vacuum interrupter starts opening to separate the feeder from the transmission system. At nearly the same time, the ground vacuum interrupter starts closing to ground the feeder circuit.

State	Electrical Time (ms)	Mech. Operating Time(ms)
Initial State	0	0
Clear Fault or	24–34	N/A
Open		
Transition	4-12	16
Open and		38
grounded		


Table 2: Electrical and mechanical operating time of the VDH/GSMI

	States of the VDH/GSMI		
State	VDH/GSMI Breaker	Line Breaker	Ground Breaker
1	Closed	Closed	Open
2	Transition (4– 12 ms)	Open	Open
3	Open	Open	Closed

Table 3: States of the VDH/GSMI

VDH/GSMI

One trip-signal, after the breaker opens (approx. 50ms), another three phase set of vacuum interupters close within in 12ms.

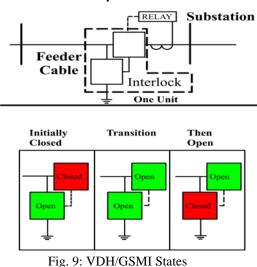

The VDH/GSMI is essential element for meeting over/under voltage ride through requirements such as those found in PRC-024-2 Page 9 of 25

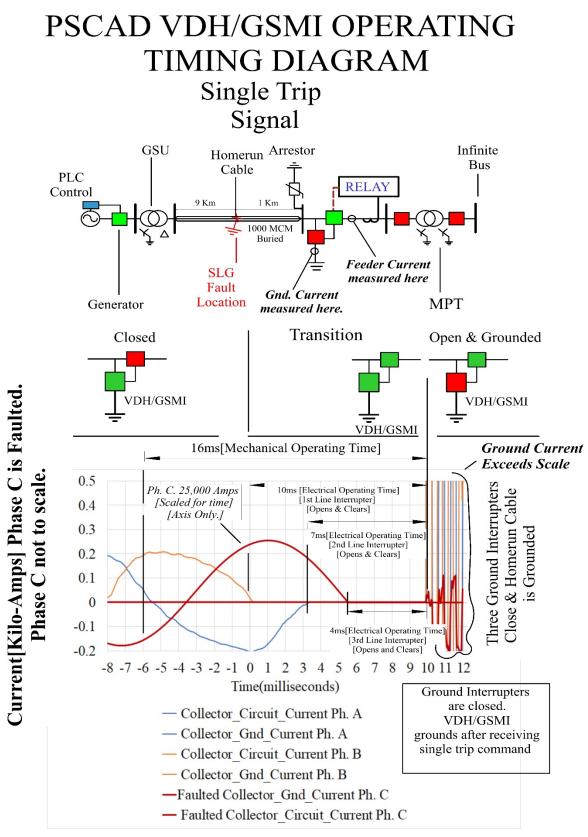


Fig. 10: PSCAD Simulation VDH/GSMI Timing Diagram.

The VDH/GSMI is essential element for meeting over/under voltage ride through requirements such as those found in PRC-024-2 Page 10 of 25


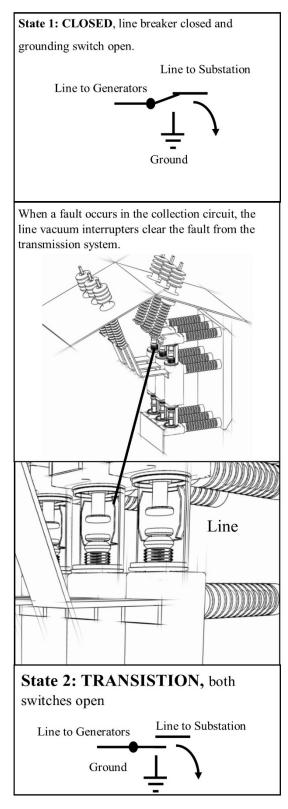



Fig. 11: VDH/GSMI Operating Sequence. The three-phase vacuum interrupters open first.

State 2: TRANSISTION (continued)

Mechanical Commutation means the period of time for opening the line breaker through closing the grounding switch. The Mechanical commutation time is **16 milliseconds**.

Electrical commutation means the period of time the collection circuit is open and isolated from the transmission system. The Electrical commutation time is 4-12 milliseconds, which is variable depending on when each pole's arc is extinguished.

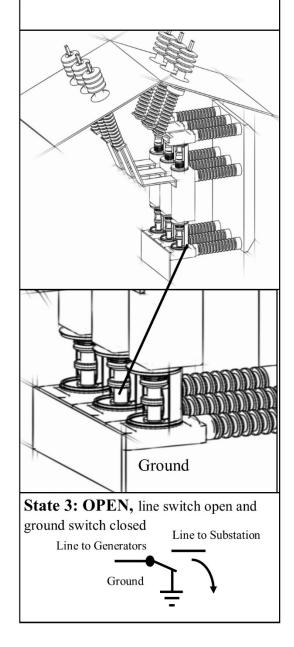

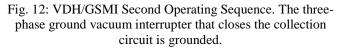

The VDH/GSMI is essential element for meeting over/under voltage ride through requirements such as those found in PRC-024-2 Page 11 of 25

Open status means the transition is complete, the line-side vacuum interrupters are open, and the grounding vacuum interrupters are closed. As a result, the feeder is electrically separated from the plant, and the phase conductors of the home run cable and the feeder circuit are now grounded at the station (Table 3). The mechanical interlock opens the line vacuum interrupter first. Then approximately 4-12 ms later, the interlock has caused the grounding vacuum interrupter to close. Concerning the opening of the line vacuum interrupters, the TP135-0 IEEE tutorial [17] on vacuum switch gear states: "Opening of a switch typically occurs at random with respect to the power frequency current, i.e. the contacts can separate at any instant. However, the current interruption takes place at the current zero. In typical medium voltage and high voltage switchgear the current waveform during the arcing phase of the switch, after the physical contact parting and before the current zero, is not significantly modified by the arcing voltage. The exception to this rule are the current limiting devices." (Figure 10)

Figure 10 shows that when the line-side breaker opens, the currents stops flowing between 4 ms and 12 ms before the ground interrupters close. When the ground interrupters close, the currents flow into three-phase bolted ground.

5. CONCERNING PSCAD VDH/GSMI SIMULATIONS

A typical simulation starts as shown in Figure 13, where the PSCAD simulation initial power level is 24 MW and 70 MW for the unaffected feeder, and the currents and voltages are symmetric and undisturbed. Figure 14 focuses on the incident energy, where the VDH/GSMI has limited the fault current sourced from the transmission system to three cycles. In addition, <u>Figure 16</u> shows that after the collection circuit is grounded, the voltage is low enough to cause the generators to go offline. (*However, the higher the impedance of the collection circuit, the less likely this will happen.*)

<u>Figures</u> 14 and 15 show the simulation with the relay picking up the fault within a quarter of a cycle or 4ms. Then the same relay sends the trip command 3ms later to the VDH/GSMI; the VDH/GSMI has opened and grounded the collection circuit 38ms later. The total clearing and grounding time is 45ms. During the transition, the lightning arrestors clamp the voltage for a very short period of time, and the burden appears below the TOV duty curve.

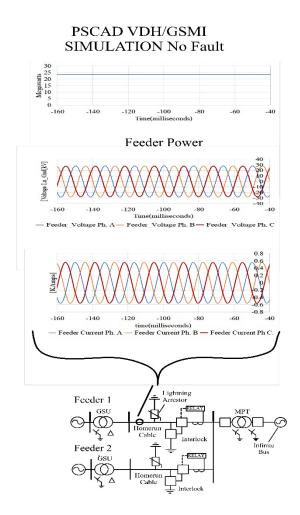


Fig. 13: PSCAD Simulation. It starts with no fault and a symmetrical feeder current. Active power is around 24 MW.

Concerning the states of the VDH/GSMI breaker, it is very important to consider the impedance of the home run section of the feeder cable during the three states of operation. Why? Because the operation of the breaker quickly transitions to ground, the collection circuit forms three-phase bolted ground on the home run cable. Therefore, this reduces the impedance looking into an end of 10-km home run cable to near 1 j ohm to ground. This can be compared to a generator step-up transformer with a positive sequence impedance of 25 ohms or a grounding transformer with similar or higher impedance.

VDH/GSMI trips the generator via grounding the collection circuit with one trip signal.


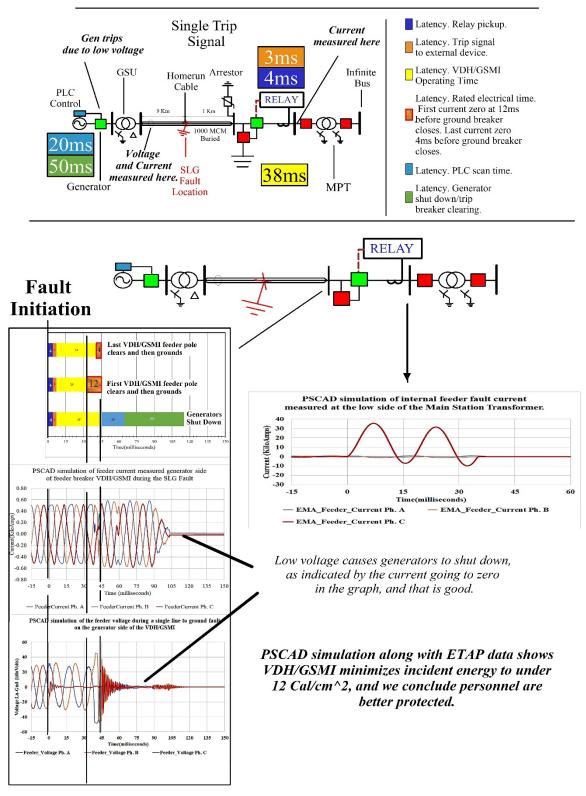



Fig. 14: PSCAD VDH/GSMI Timing Diagram.

The VDH/GSMI is essential element for meeting over/under voltage ride through requirements such as those found in PRC-024-2 Page 13 of 25

Concerning islanding of the collection circuit the VDH/GSMI causes the feeder's voltage to remain within MCOV limits of the lightning arrestor.

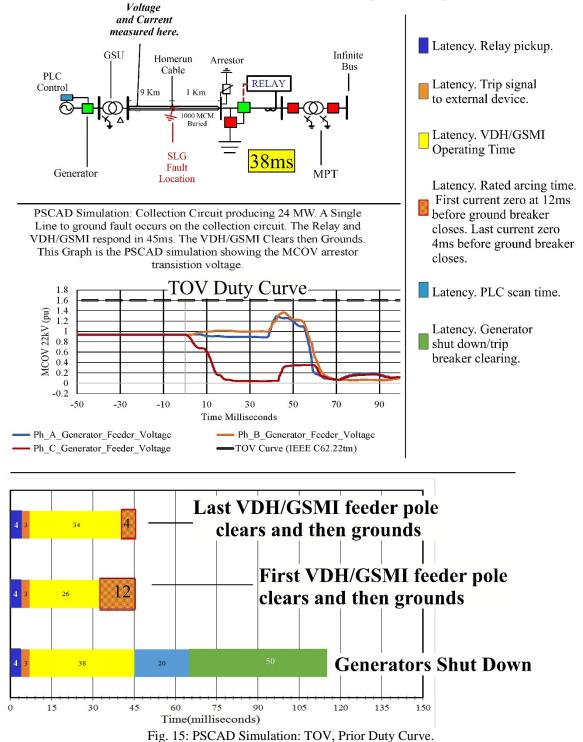

The VDH/GSMI is essential element for meeting over/under voltage ride through requirements such as those found in PRC-024-2 Page 14 of 25

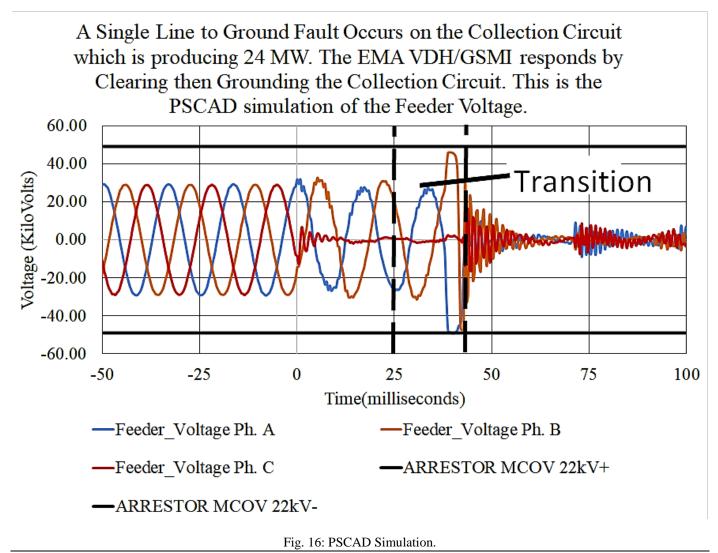

Figures 15 and 16 show the maximum continuous operating voltage (MCOV) rating of the lightning arrestor of 22 kV. The line to ground voltage rating of the collection circuit is 19.920 kV.

In this case, as shown in <u>Figure</u> 16 when the VDH/GSMI switches feeder Phase C races up, however, the ground interrupter closes fast enough to prevent the voltage from exceeding the duty curve.

In <u>Figure</u> 16, after the ground interrupters close, the feeder voltage drops significantly and provides support for the generators so that they could potentially be set to differentiate between an internal plant fault and an external transmission

system fault. Figure 16 indicates a type of ringing with the change in impedance. However, within 20ms the voltage is clearly approaching zero and is low enough for the generators to shut down.

The PSCAD simulation shows that the VDH/GSMI clearly can protect and make it easier for engineers to perform ride-through coordination concerning events within the plant and events outside on the transmission system. The PSCAD simulation also shows that a coordination study for a collection circuit should be performed with a VDH/GSMI, as every plant design is different, and the transients are not the same.

6. PSCAD MODELING

For emulating type 3 and type 4 wind turbines or inverters, Figure 17 shows the PSCAD single line model with two aggregate generators. The model emulates a wind power plant or a solar power plant with a type 4 wind generator or inverter-based generation.

The generators use a Clarke/Park [18] transform that follows voltage at the transformer mains. The plant is rated at approximately 100 MW. The main plant transformer is rated over 100 MVA. Without fans, it is rated at 90 MVA oil natural air natural (ONAN), with ½ fans it is rated 120 MVA oil natural air forced (ONAF), with all fans it is rated at 150 MVA (ONAF). There are two feeders. One feeder is an equivalent feeder (75 MW), and the other is the faulted feeder (25 MW). On the faulted feeder is the home run cable. The production values concerning active power(P) reactive power (Q) and voltage (V) are allowed to fluctuate within a narrow band.

The home run cable is represented by an infinite pi model of varying distances. In PSCAD, this model is called a Bergeron model as shown in <u>Figure 20</u>. The VDH/GSMI is shown in <u>Figures 17</u> and 19. The line breaker, remote trip, and grounding breaker relay model are also provided in Figure 19. The simulation is very simple and consists of time delays for the relays to open the appropriate breaker, while the generators produce power, and a single line to ground fault occurs on the home run cable or a three-phase bolted fault occurs at the point of interconnection. Although the line and grounding breakers are interlocked, the control is reflected by using appropriate delays. Next, concerning remote transfer trip a delay is used to emulate the breaker delay at the generators.

Figure 18 is a model of the timing of the relays used to open and close the appropriate breaker. For example, in a simulation, the Vac_Interrupter_Line signal causes the line breaker in the VDH/GSMI to open. Then the Vac_Interrupter_Gnd signal causes the VDH/GSMI ground breaker to close. Concerning Remote_Trip, the delay provides enough time to shut down the generators within the wind power plant or solar power plant before the line breaker opens. Depending on the simulation, the Remote_Trip signal or Vac_Interrupter_Gnd signal may or may not be used in the simulation. An example of this is simulating the worst-case TOV and not allowing the feeder VDH/GSMI ground breaker to close or allow the wind turbine's breaker to open.

The model begins with a very strong source rated greater than 1000 MVA. The main plant transformer (see Figures 19 and 25) is rated at 90 MVA at 8% impedance with a 30 to 1 X/R ratio, with a nominal voltage at 230 kV line to line on the high side and 34.5 kilovolts line to line on the low side. In this simulation, the high-side and low-side breakers connected to the main plant transformer are set to remain closed. The equivalent feeder is set to produce at 75 MW, and the faulted feeder is set to produce 25 MW. Reactive power is set to flow near zero, and depending on the simulation, that value is adjusted. The voltage at the point of interconnection is set at 1 pu. In addition, a three-phase bolted fault is added to create the nine cycles of zero voltage at the point of interconnection to characterize the VDH/GSMI's contribution to the generation plants' reliability and stability.

Figure 21 is the three-phase PSCAD cable model. Figures 22 and 23 provide R, X, and B for the cable. The impedance of a leg can be calculated by looking into the 1000 MCM home run cable from the junction box to the main plant transformer and using the manufacturer's specified data for a 1000 MCM direct buried cable. However, PSCAD can do this, and we use PSCAD's cable constant's positive sequence impedance XL, positive sequence resistance R, and susceptance B.

7. CALCULATIONS

The following equations are taken from [9] and are used to go back and forth between pu unit and actual values:

$$I_{base} = \frac{S_{base}}{3\sqrt{3}V_{base}}$$
(1)

$$Z_{base} = \frac{\left(\frac{V_{base}}{\sqrt{3}}\right)^2}{\frac{S_{base}}{3}}$$
(2)

$$P_{hass} = S_{hass}$$
(3)

$$Z_{MPT} = Z_{base} * (Z_{[pu]MPT})$$
⁽⁴⁾

For example (models provided in <u>Figures</u> 23, 24, and 25), considering the 230 kV/34.5 kV main plant transformer with 8% (X/R ratio of 30:1) impedance on the 34.5 kV bus, rated at 90 MVA, and connected to an infinite bus, the calculated impedance is

$$Z_{mpt} = \frac{\left(\frac{34,500 \ Volts}{\sqrt{3}}\right)^2}{\frac{90,000,000}{3}} = 13.225 \ Ohms$$
$$X_l = 0.08 * 13.225 = +1.05 \ jOhms$$
$$R = \frac{1}{30} * 1.05 = 0.035 \ Ohms$$

Therefore, we find that the impedance looking into the main plant transformer is approximately 1 ohm.

We can use the same equation to calculate the impedance of the step-up transformer at each type 3 or type 4 wind turbine or solar inverter or even a grounding transformer.

The VDH/GSMI is essential element for meeting over/under voltage ride through requirements such as those found in PRC-024-2 Page 16 of 25

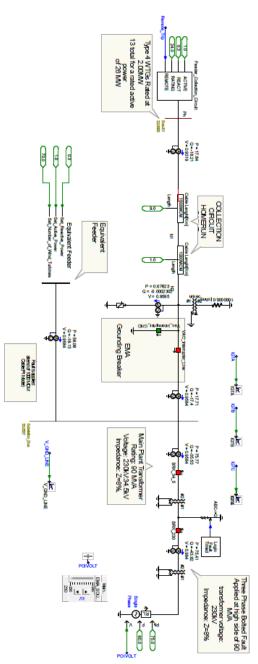


Fig. 17: PSCAD Model: Single Line.

RELAY	
Timed Breaker Logic Closed@t0	VAC_Interrupter_Line
Timed Breaker Logic Open@10	►o Remote_Trip
Timed Breaker Logic Open@t0	Vac_Interrupter_GND

Fig. 18: Breaker(s) Timing.

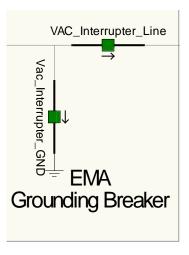


Fig. 19: EMA Line and Grounding Breaker Model.

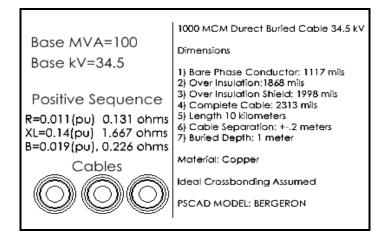


Fig. 20: PSCAD Line Constants Model 10 km (note for aluminum, the values are R=0.014 (pu), XL=0.15 pu (ohms), B=0.228 (pu)). In this paper, we use copper where the values are nearly the same. (See Figure 22.) In the following figures, the cable is separated into 1 km and 9 km lengths.

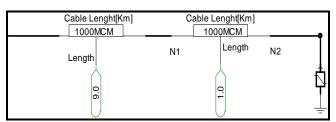


Fig. 21: PSCAD Cable Model (the 10-km model separated into 1 km and 9 km sections).

Per-Unit Quantities Based On:
Base Voltage: 34.50 kV, L-L,RMS
Base MVA: 100.00 MVA
LONG-LINE CORRECTED SEQUENCE RESISTANCE
RLLsq [p.u.]:
+ Seq. Self: 0.114015367E-02
0 Seq. Self: 0.208521907E-01
LONG-LINE CORRECTED SEQUENCE REACTANCE
XLLsq [p.u.]:
+ Seq. Self: 0.148258142E-01
0 Seq. Self: 0.675852755E-02
LONG-LINE CORRECTED SEQUENCE SUSCEPTANCE
BLLsq [p.u]:
+ Seq. Self: 0.197606297E-02
0 Seq. Self: 0.197606034E-02

Fig. 22: PSCAD 1 km 1000 MCM Cable Parameters.

```
Per-Unit Quantities Based On:
Base Voltage: 34.50 kV,L-L,RMS
Base MVA: 100.00 MVA
LONG-LINE CORRECTED SEQUENCE RESISTANCE
RLLsq [p.u.]:
    + Seq. Self: 0.102533611E-01
    0 Seq. Self: 0.187602863
LONG-LINE CORRECTED SEQUENCE REACTANCE
XLLsq [p.u.]:
    + Seq. Self: 0.133378508
    0 Seq. Self: 0.609190208E-01
LONG-LINE CORRECTED SEQUENCE SUSCEPTANCE
BLLsq [p.u]:
    + Seq. Self: 0.177880411E-01
    0 Seq. Self: 0.177861250E-01
```

Fig. 23: PSCAD 9 Mile 1000 MCM Cable Parameters.

3 Phase Transformer MVA	30.25
Base operation frequency	60
Winding #1 Type	0
Winding #2 Type	1
Delta Lags or Leads Y	1
Positive sequence leakage reactance	0.02
Ideal Transformer Model	1
No load losses	0.00135
Copper losses	0.00765
Tap changer on winding	0
Graphics Display	2
Display Details?	0
Winding 1 Line to Line voltage (RMS)	0.575
Winding 2 Line to Line voltage (RMS)	34.5
Saturation Enabled	1
Saturation Placed on Winding	2
Air core reactance	0.2
In rush decay time constant	1
Knee voltage	1.25
Time to release flux clipping	0.1
Magnetizing current	1

Fig. 24: WTG Aggregate Transformer Parameters.

Transformer Name	TI
3 Phase Transformer MVA	90.0 [MVA]
Base operation frequency	60.0 [Hz]
Winding #1 Type Winding #2 Type Delta Lags or Leads Y	1 0 1
Positive sequence leakage reactance	[uq] 80.0
Ideal Transformer Model	0
No load losses	[uq] 100.0
Copper losses	0.0001 [pu]
Tap changer on winding	0
Graphics Display Display Details?	2
Winding 1 Line to Line voltage (RMS)	230 [k∨]
Winding 2 Line to Line ∨oltage (RMS)	34.5 [kV]
Saturation Enabled Saturation Placed on Winding	1
Air core reactance	0.2 [pu]
In rush decay time constant	0.0 [s]
Knee voltage	1.17 [pu]
Time to release flux clipping	0.0 [s]
Magnetizing current	1 [%]

Fig. 25: MPT Transformer Parameters.

Concerning PRC-024-2, the voltage increases across padmount transformers is due to the current and the angle across the transformer impedance which dominates in value over the branch impedance when the home run cable is bolted to ground. Typically, the impedance of a generator transformer is 5.5% with an X/R ratio of 30 to 1 and a rated MVA of between 2.5 and 3 MVA which is calculated for 2.5 MVA at 0.866 + j26.2 ohms or 3 MVA at 0.726 + j21.8 Ohms. Considering an equivalent 30 MVA transformer representing 10 generators is j2.18 Ohms (See Table 1). The branch of feeder impedance is assumed to be much lower than the transformer impedance and is estimated at 1.4 + j1.3 ohms. The impedance of a 10-km home run cable from PSCAD is 0.131 + j1.67 ohms. The positive/negative sequence impedance of a grounding transformer is assumed to be the same as the padmount transformer except that it is open on the secondary, resulting in a very high positive/negative sequence impedance at the grounding transformer and the path to ground is then through the lighting arrestors when the conduct.

The calculations show the VDH/GSMI provides relatively low impedance when it opens and shorts the home run cable to ground. Within a range of fault locations on the cable, the impedance of the cable remains low compared to the impedance at each transformer at each wind turbine. With this in mind, the wind turbines or inverters are hard-pressed to remain on-line when the grounding breaker closes. When the ground breaker operates and is in state 3, the impedance is so low that a type 3 or type 4 wind turbine [10] that is limiting its current will be hard-pressed to keep its voltage up and will trip offline because the voltage is so low.

8. PSCAD TRANSIENTS AND MODELING METHODOLOGY

The focus of this paper is the grounding breaker and PRC-024-2 and how each can protect a collection circuit within a wind power plant. We use PSCAD to model switching transients and other electro-dynamic and control system events. The simulation focuses on the impact of various faults on a specific collection system feeder circuit when the wind power plant or solar power plant uses line breakers, grounding breakers, and remote trip protection arrangements.

9. DISCUSSION

Generally, Figure 26 concerns PSCAD simulations of inverter-based generation and how at the point of interconnection the voltage recovers and an affected collection circuit that the VDH/GSMI pulls the collection circuit voltage very low where it would be easy for a generator to differentiate whether the fault were external or internal to the plant. For external faults, the impedance to the generators is from the main plant transformer, the collection cables, and the generator step-up transformer. For internal faults, the main plant transformer is excluded.

The VDH/GSMI is essential element for meeting over/under voltage ride through requirements such as those found in PRC-024-2 Page 21 of 25 Figures 26 and 27 also shows how the PSCAD simulations of the VDH/GSMI may protect and provide support to the faulted collection circuit and the transmission system. The VDH/GSMI forms three-phase bolted ground and provides a zero reference closer to the generators than the zero reference that forms with three-phase bolted ground at the point of interconnection; the difference in impedance between internal faults and external faults is the impedance of the main plant transformer where the main plant transformer has an impedance of 8%. Figure 27 shows at near full power for the wind power plant or solar power plant that the delta in voltage between the two fault locations is 8%. As a result, each generator could detect and discriminate between each fault location. Therefore, the VDH/GSMI provides signaling between an islanding event or ride-through event.

10. CONCLUSION

A VDH/GSMI once grounded creates three-phase bolted ground on the home run cable. This, in turn, creates an impedance on the home run cable of less than 2 ohms as seen from the junction box to the VDH/GSMI for a 1000 MCM cable that is 10 km long. If we compare the home run cable impedance to that of the generator step-up transformer impedance, which is j28 ohms at 34.5 kV, the ratio is approximately 15 to 1.

When the home run cable is grounded by the VDH/GSMI, each generator limits the current to a maximum magnitude during the fault of approximately 42 amps at 34.5 kV, and the voltage rise across the generator step-up transformer is less than 1.1 kV.

At that point, each generator should trip off-line, and islanding should not occur. In addition, and with the above in mind, each generator should coordinate well with the

PRC-024-2 requirements. However, if islanding does occur, the impedance is so low that temporary overvoltages should not be present while the generators wait to receive a remote trip signal from the substation.

Concerning PRC-024-2, the VDH/GSMI signals the wind turbines that the fault is inside the plant and shuts them down for events that the turbines should not ride through, therefore providing a valuable discriminatory function that standard circuit breakers do not. With PSCAD simulations, we showed that the VDH/GSMI causes a lower voltage to appear at the terminals of the generators for internal faults than for external faults (See figure 27). Therefore, the generators are shut down faster than remote trip, and if remote trip is needed, the very low impedance measured on the collection circuit will protect the generators.

With PSCAD simulations, we discuss PRC-024-2 with the VDH/GSMI for wind power plants or solar power plants. After the VDH/GSMI opens and clears and then closes and grounds

the collection circuit, the VDH/GSMI provides an impedance to ground that is sufficient for signaling the generators to shut down or provides a benign islanding impedance.

Presented in this paper is a sequence of events and an operational overview concerning the VDH/GSMI for wind power plants and solar power plants. With the VDH/GSMI in mind, we draw the following conclusions:

1. The VDH/GSMI operates two vacuum interrupters with an interlock; therefore, the VDH/GSMI operates with only one signal.

2. The transition state of the VDH/GSMI where both vacuum interrupters are open is from 4 to 12ms.

3. The operation of a VDH/GSMI demonstrates a clear change in impedance as the VDH/GSMI operates; then the generators can detect such a change and act on it.

4. The VDH/GSMI when closed to ground results in a very low impedance of the home run cable to less than 2 ohms measured from a junction box (1000 MCM less than 10 km).

5. Given the typical design variations in wind power plants and solar power plants and generators with current limiting capability, the VDH/GSMI should provide very low impedance on the feeder circuit and cause the AC mains voltage at each generator to go below the minimum operating voltage and force them off-line to prevent islanding.

The PSCAD simulations show the VDH/GSMI provides designers and engineers the ability to distinguish between external and internal faults as shown in figures 26 and 27, where generators may be set to trip if the fault is in the plant or ride through if the fault is outside the plant. The VDH/GSMI completely operates in less than 50ms to separate the affected

collection circuit and ground it, so it collapses the voltage allowing islanding if needed. As a result, we conclude that the use of the VDH/GSMI in the design and construction of generating projects, such as wind power plants and solar power plants, constitutes a best practice.

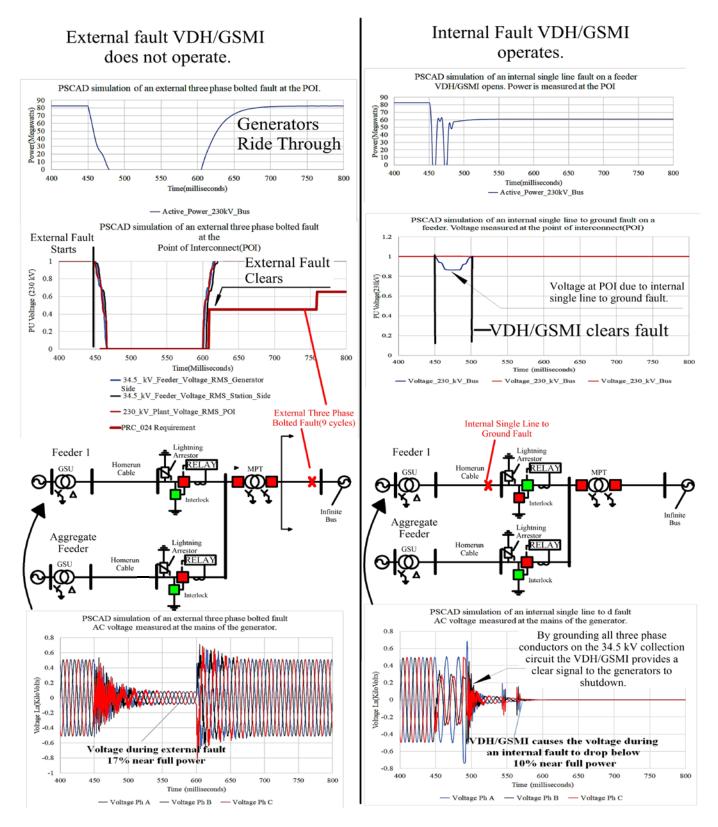


Fig. 26: External and Internal Faults.

The VDH/GSMI is essential element for meeting over/under voltage ride through requirements such as those found in PRC-024-2 Page 23 of 25

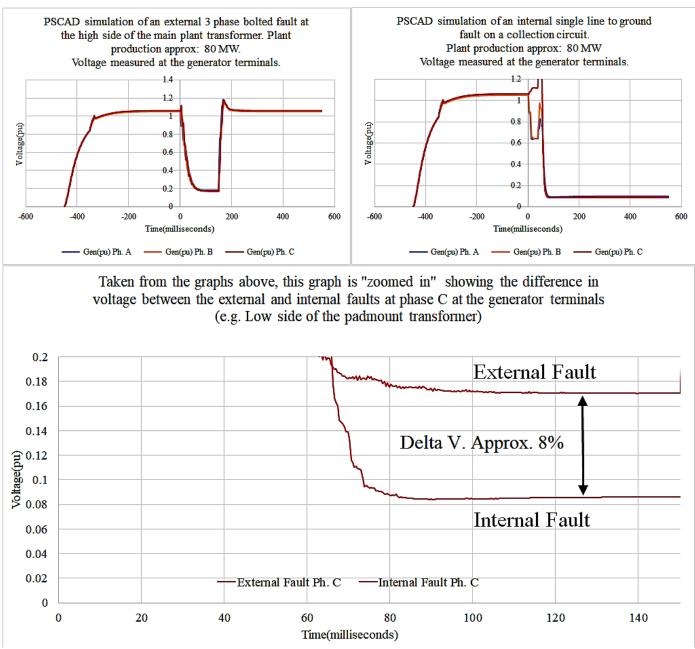


Fig. 27: Delta V. External and Internal Faults (Gen. Protection Disabled).

11. ACKNOWLEDGMENT

The authors thank all of those who work with EMA for their support to produce this paper concerning the design and operation of the VDH/GSMI for wind power plants and solar power plants.

REFERENCES

[1] http://www.ema-sa.com.ar/catalogos/GSMI.pdf

[2] E. Montich, "Circuit breaker with high speed mechanically-interlocked grounding switch," USPTO Patent 7724489, Aug 2007

[3] R. Elliot, "Problems and Solutions Grid Planning and Reliability Policy Paper, California Public Utilities Commission, 2014, Glossary.

[4] A. Kulkarni, J. Payne, and P. Misretta, "Integrating SCADA, Load Shedding and High Speed control on an Ethernet Network at a North American Refinery," IEEE Petroleum and Chemical Industry Technical Conference 23-25 September 2013.

[5] R, Downer, "Wind Farm Electrical Systems", IEEE Atlanta IAS Chapter, 2009.
ewh.ieee.org/r3/atlanta/ias/Wind%20-Farm%20Electrical%20Systems.pdf

[6]

https://www.dmme.virginia.gov/dmm/PDF/TRAINING/REFR ESHER/electricaltopics/arcflash,blast.pdf

[7] M.B. Schulman and P.G. Slade, "Sequential Modes of Drawn Vacuum Arcs Between Both Contacts for Currents in the Range 1 kA to 16 kA," IEEE Transactions on Components, Packaging and Manufacturing Technology, Vol. 18, No. I, pp. 417-422, March 1995

[8] P.G. Slade, "The Vacuum Interrupter Contact," IEEE Transactions on Components, Packaging and Manufacturing Technology, Vol. 7, No. 1, pp. 25-32, March 1984

[9] Elgred-Electric Energy System Theory, an Introduction, McGraw-Hill; Gross-Power System Analysis, Wiley; Neuenswander-Modern Power Systems, International Textbook; Stevenson-Elements of Power System Analysis, McGraw-Hill Education, 1994

[10] Joint Working Group, Fault Current Contributions from Wind Plants: A Report to the Transmission & Distribution, Power System Relaying and Control Committee, IEEE Power and Energy Society, 2013

 [11] PJM Wind Power Plant Short-Circuit Modeling Guide August 2012 standards include, but are not limited to: ANSI/IEEE C37.101 Guide for Generator Ground Protection

ANSI/IEEE C37.102 Guide for AC Generator Protection

ANSI/IEEE C37.106 Guide for Abnormal Frequency Protection for Power Generating Plants

ANSI/IEEE C37.95 Guide for Protective Relaying of Utility-Consumer Interconnections

ANSI/IEEE C37.91 Guide for Protective Relay Applications to Power Transformers

IEEE 1547 Standard for Interconnecting Distributed Resources with Electric Power Systems

[12] M.A. Ahmed, Communication Network Architectures for Smart-Wind Power Farms, www.mdpi.com/journal/energies, pg. 3904-3905, June 2014

[13] M.A. Ahmed, Hierarchical Communication Network Architectures for Offshore Wind Power Farms, www.mdpi.com/journal/energies pg. 3426, March 2014.

[14] J.F. Davis, M. Subudhi, and D.P. Cornell, *Aging Assessment of Surge Protective Devices in Nuclear Power Plants*, U.S. Nuclear Regulatory Commission, 1996

[15] National Electric Reliability Corporation (NERC) Standard PRC-024-2 — Generator Frequency and Voltage Protective Relay Settings

[16] UNITED STATES OF AMERICA FEDERAL ENERGY REGULATORY COMMISSION 18 CFR Part 35 (Docket No. RM05-4-001; Order No. 661-A) Interconnection for Wind Energy (Issued December 12, 2005) Pg. 10.

[17] TP-135-0. IEEE TUTORIAL ON THE. VACUUM SWITCHGEAR

[18] Handcock Matrix Analysis of Electrical Machinery, Permagon Press, 1964, pp. 83-109

[19] Wilkins, Downing, "Interlocked Combined Breaker Grounding Switch (VDH/GSMI) provides better protection for insulation coordination than a grounding transformer. We present the reasons why.", August, 2017

The VDH/GSMI is essential element for meeting over/under voltage ride through requirements such as those found in PRC-024-2 Page 25 of 25